

CLAMP-ON METERS

500 SERIES (CONTINUED)

MODEL 514


Full ranges and compliance to international safety and quality standards ensure a professional and reliable tool

SPECIFICATIONS

MODELS	514 TRMS
AC Current (Auto-Ranging)	(0.05 to 1000) Arms
Resolution	(0.01, 0.1 and 1) A
AC Voltage (Auto-Ranging)	(0.5 to 750) Vrms
Resolution	0.1 V and 1 Vrms
Input Impedance	10 MΩ
DC Current (Auto-Ranging)	(1 to 1000) A
Resolution	0.01 A, 0.1 A and 1 A
DC Voltage (Auto-Ranging)	(0.2 to 1000) V
Resolution	0.1 V and 1 V
Input Impedance	10 MΩ
Resistance	(0.2 to 4000) Ω
Max Test Voltage	3 Vdc
Diode Test	1.7 mA
Open Circuit Voltage	3 Vdc
Continuity	< 40 Ω
Max Test Voltage	3 Vdc
Frequency (Auto-Ranging)	
CURRENT INPUT Range	4 kHz 1 Hz Resolution 10 kHz 10 Hz Resolution
Min Input Signal	2 Arms 5 Arms
VOLTAGE INPUT Range	4 kHz 1 Hz Resolution 10 kHz 10 Hz Resolution
Min Input Signal	5 Vrms 10 Vrms
Power Supply	9 V Alkaline battery (included)
ENVIRONMENTAL	
Operating Temperature	(* -14 to 122) °F (-25 to 50) °C, 80 % RH, non-condensing

Consult factory for NIST Calibration prices

*Note: If Model 514 is to be used below 32 °F (0 °C), we suggest that the battery be replaced to ensure proper results.

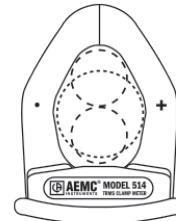

Jaw Opening: 1.575 in (40 mm)
Conductor Size: (1) 750 kcmil cable or
(2) 350 kcmil cables



514



FEATURES

- Standard size, full function clamp-on meter
- 1000 Aac or 1000 Aac/dc current measurements
- Measures up to 750 Vac and 1000 Vdc
- TRMS measurements
- Resistance measurements to 4000 Ω
- Continuity with beeper below 40 Ω
- Frequency measurements from V and A
- Diode test
- 1 ms peak function for fast capture of signals
- Hold function to freeze readings
- Push-button for easy A/c zeroing
- Large, easy-to-read, 4000-count LCD display
- 42-segment analog bargraph
- Includes test leads, soft carrying pouch and batteries

PRODUCT INCLUDES

Soft carrying case, set of (2)
color-coded (red/black)
test leads with probe tips,
9 V battery and user manual.



CATALOG NO.	DESCRIPTION
2117.70	Clamp-on Meter Model 514 (AC/DC, TRMS, 1000 Aac/dc, 750 Vac/1000 Vdc, Hz, Ohms, Continuity)



Vol. 23 Rev.00 02/2023

Technical Assistance (800) 343-1391

© Chauvin Arnoux, Inc. d.b.a. AEMC Instruments. All Rights Reserved.

www.aemc.com

11

CLAMP-ON METERS

SELECTION GUIDE

Models	Catalog Number	Type	AC Current	AC Voltage	DC Current	DC Voltage	Resistance (Ω)	Continuity	Frequency (Hz)		Jaw Size	Dimensions
									Current	Voltage		
205	2139.40	AC/DC TRMS	600 A	1000 V	900 A	1000 V	60 k Ω	< 40 Ω	3 kHz	20 kHz	1.34 in (34 mm)	(8.7 x 3.1 x 1.65) in
403	2139.21	AC/DC TRMS	1000 A	1000 V	1500 A	1000 V	100 k Ω	< 40 Ω	2 kHz	20 kHz	1.89 in (48 mm)	(10.7 x 3.6 x 1.6) in
405	2139.50	AC/DC TRMS	1000 A	1000 V	1500 A	1000 V	100 k Ω	< 40 Ω	2 kHz	20 kHz	1.89 in (48 mm)	(10.7 x 3.6 x 1.6) in
407	2139.51	AC/DC TRMS	1000 A	1000 V	1500 A	1000 V	100 k Ω	< 40 Ω	2 kHz	20 kHz	1.89 in (48 mm)	(10.7 x 3.6 x 1.6) in
603	2139.31	AC/DC TRMS	2000 A	1000 V	3000 A	1000 V	100 k Ω	< 40 Ω	1 kHz	20 kHz	2.36 in (60 mm)	(11.65 x 4.37 x 1.61) in
607	2139.61	AC/DC TRMS	2000 A	1000 V	3000 A	1000 V	100 k Ω	< 40 Ω	1 kHz	20 kHz	2.36 in (60 mm)	(11.65 x 4.37 x 1.61) in
505	2139.82	AC/DC TRMS	400 A	600 V	400 A	600 V	600 Ω	< 35 Ω	400 Hz	400 Hz	1.18 in (30 mm)	(7.83 x 2.95 x 1.42) in
514	2117.70	AC/DC TRMS	1000 A	750 V	1000 A	1000 V	4000 Ω	< 40 Ω	10 kHz	10 kHz	1.58 in (40 mm)	(9.53 x 2.60 x 1.42) in
566*	2139.83	AC TRMS	100 A	600 V	—	600 V	600 k Ω	< 45 Ω	500 Hz	500 Hz	0.91 in (23 mm)	(8.27 x 3.0 x 1.32) in
CM605	7000.02	AC/DC	100 A	600 V	100 A	600 V	9999 Ω	< 100 Ω	500 Hz	500 Hz	0.60 in (15 mm)	(7.95 x 2.76 x 1.33) in

*Model 566 can be found in the Leakage Current Meters & Probes on Page 80
Consult factory for NIST Calibration prices